DIGITAL CONDUCTIVITY METER MODEL 1152 OPERATION MANUAL



EMCEE ELECTRONICS, INC. 520 CYPRESS AVENUE VENICE, FL 34285 (941) 485-1515 FAX 941-488-4648

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 1 of 19

	TABLE OF CONTENTS Page N	<u>o</u> .
1.0	Scope	4
2.0	Significance	5
3.0	Definition	5
4.0	Summary of Method	5
5.0	Apparatus	6
6.0	Preparation of Sample	7
7.0	Test Procedure	8
8.0	Precision	10
9.0	Battery Replacement	11
10.0	Calibration	12

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 2 of 19

	<u>TA</u>]	BLE OF CONTENTS Page 1	<u>No</u> .				
1.0 Photographs							
	Figure 1	1152 with Probe attached	13				
	Figure 2	Probe Calibration Number	14				
	Figure 3	Zero Check	15				
	Figure 4	Calibration Check	16				
	Figure 5	Fuel Evaluation	17				
	Figure 6	Conductivity Meter with Cable Reel attached	18				
	Figure 7	Battery Replacement	19				

Service & Warranty Policy

See Emcee Electronics, Inc Service and Warranty Manual

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 3 of 19

1

1.0 SCOPE

The Emcee Conductivity Meter is a reliable, convenient and inexpensive instrument for measuring the electrical conductivity of fuels. The monitor incorporates all solid-state components and is completely self-contained. Several instruments are available for various ranges.

Model	Multiplier	Range
152-00-0000	x 1	0 - 2,000 pS/m
152-00-0001	x 10	0 - 20,000 pS/m
152-00-0003	X 100	0 - 200,000 pS/m
152-00-0007	x 1,000	0 - 2,000,000 pS/m
152-00-0008	X 10,000	0 - 20,000,000 pS/m

The instrument will display units between 0 and 1999. The conductivity is equal to the reading times the instrument multiplier and is reported in picosiemens/meter (pS/m). The instrument has a simple calibration and zero check; and indicates when the conductivity level exceeds the upper range of the meter by displaying 1--- on the LCD display.

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 4 of 19

2.0 SIGNIFICANCE

Fuel products such as jet and diesel fuels which are loaded at high pumping rates, develop a static charge. The Emcee Conductivity Meter measures the ability of the fuel to dissipate that charge.

3.0 DEFINITION

The Emcee Conductivity Meter reads conductivity in picosiemens/meter which are equivalent to CU or Conductivity Units.

4.0 SUMMARY OF METHOD

The Emcee Conductivity Meter uses a probe consisting of two concentric stainless steel electrodes. When the probe is immersed in fuel, a constant voltage is applied to the electrodes. This results in an electrical current which is amplified and indicated on the meter.

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 5 of 19

5.0 APPARATUS

- 5.1 The Emcee Conductivity Meter with Fuel Probe is shown in Figure 1. The meter is a hand held, battery operated portable instrument.
- 5.2 The controls shown in Figure 1 consist of a measure switch and a calibrate switch.
- 5.3 Figure 2 shows the location of the probe calibration number.
- 5.4 Figure 3 shows the instrument zero check.
- 5.5 Figure 4 shows the instrument calibration check.
- 5.6 Figure 5 shows a typical fuel test.

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

5.7 The Accessory Cable Kit shown in Figure 6 includes a portable reel with a 50' cable. This kit enables the operator to connect the probe to the 50' cable for use in a large tank. The kit also is supplied with a grounding cable for attachment between the conductivity meter and tank ground.

6.0 PREPARATION OF SAMPLE

The sample container (preferably a one liter metal container) should be cleaned with a solvent and rinsed with the fuel to be tested. After the sample for test has been withdrawn, wait approximately two minutes for charges in the fuel to dissipate.

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 7 of 19

7.0 TEST PROCEDURE

- 7.1 Attach probe to bottom connector on conductivity meter.
- 7.2 Depress MEASURE switch (M) with probe OUT of fuel sample. Reading should be 000 +/- 001 in approximately 3 seconds (Figure 4). If reading is outside limits, remove probe and recheck zero by depressing MEASURE switch
- 7.2.1 If zero adjustment is okay without probe but not when probe is attached, the probe should be thoroughly rinsed with isopropyl alcohol followed by reagent grade toluene and allowed to air dry before retesting for zero.
- 7.2.2 If the reading is outside of limits with the probe removed, perform calibration procedure outline in Section 10.0.
- 7.3 Depress CALIBRATE switch (C) with probe OUT of fuel sample. After 3 seconds, reading should be 10 times the probe calibration number +/- 005 (Figure 4).

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

SAMPLE

Probe No. = 40Meter Reading = 400 + / - 5 or 395 to 405

7.4 Insert probe in fuel to upper holes and depress MEASURE switch. Report displayed reading times multiplier after 3 seconds for stabilization. (Due to the polarization of the fuel sample the apparent reading will continue to change. Only the reading 3 seconds after depressing the MEASURE switch is correct).

<u>Note</u>: If a "1" is displayed on the left side of the display, the conductivity level exceeds the upper range of the meter.

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 9 of 19

8.0 PRECISION

The electrical parameters are factory calibrated to 1% of reading. However, due to fuel measurement characteristics, the repeatability and reproducibility limits are as follows:

PS/M	REPEATABILITY	REPRODUCIBILITY
50	4	12
100	6	18
150	8	23
200	9	27
250	10	30
300	11	34
400	5%	10%

Limits Applicable at Room Temperature only.

Precision based on ASTM Round Robin test of standard 0 - 2,000 pS/m meter.

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 10 of 19

9.0 BATTERY REPLACEMENT

- 9.1 The Model 1152 Conductivity has an internal battery checking circuit. If batteries are weak the meter will read for a short time and shut itself off. If batteries are too low the unit will not turn on.
- 9.2 When battery replacement is indicated remove the 4 screws holding the back plate exposing the battery housing at the top of the meter.
- 9.3 Remove the 2 screws on the battery housing and set the housing cover to one side (Figure 7).
- 9.4 Observe the polarity markings and insert three new batteries as shown in Fig. 7. Battery replacement must be (3) 6 volt Alkaline Neda 1414A (A-544). Any other battery replacement will invalidate the Intrinsically Safe Rating.
- 9.5 Replace back panel and check zero and calibration.

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 11 of 19

10.0 CALIBRATION

- 10.1 If either ZERO or CALIBRATE is outside the limits listed in 7.2 or 7.3 the following steps should be completed.
- 10.2 Remove the probe.
- 10.3 Insert a small screwdriver into the hole marked ZERO while depressing the MEASURE switch. Adjust the control until the display reads 000 + 001.
- 10.4 While depressing the CALIBRATE switch, insert a small screwdriver into the CALIBRATE hole and adjust for 10 times the probe calibration number +/- 002.
- 10.5 Attach the probe and depress the MEASURE switch. The reading should be 000 + / 001. If zero adjustment is okay without probe but not when probe is attached the probe should be thoroughly rinsed with isopropyl alcohol followed by reagent grade toluene and allowed to air dry before retesting for zero.

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 12 of 19



Figure 1

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 13 of 19



Figure 2

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 14 of 19



Figure 3

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 15 of 19



Figure 4

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 16 of 19



Figure 5

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 17 of 19



Figure 6

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 18 of 19

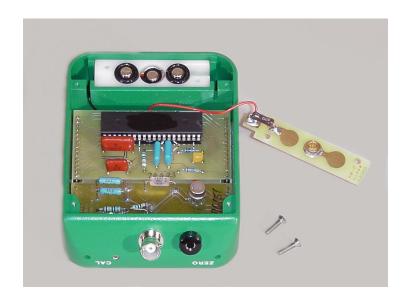


Figure 7

The information contained in the accompanying document is proprietary and confidential, and may not be copied in any manner whatsoever without prior written consent of Emcee Electronics, Inc. The document and the material therein may not be used for any purpose other than that intended by Emcee Electronics, Inc.

COPYRIGHT 1984 EMCEE ELECTRONICS, INC.

REVISION DATE: OCTOBER 3, 2001

Page 19 of 19